


4221

LEGEND AND NOTES

- FOUND SECTION CORNERS AS DESCRIBED ON PLAT ON PREVIOUS SURVEYS
- FOUND QUARTER CORNERS AS DESCRIBED ON PLAT ON PREVIOUS SURVEYS
- FOUND VARIOUS MONUMENTS AT OR NEAR LOT CORNERS: SEE COLUMN AT RIGHT
- FOUND 5/8"x24" REBAR USED TO CONTROL THIS SURVEY
- FOUND ORIGINAL HUB LYING ON GROUND NEXT TO METAL SIGN POST AT LOT CORNER
- SET 5/8"x24" REBAR WITH PLASTIC CAP STAMPED "ALLRED SURVEYING" AT LOT CORNERS
- EXISTING FENCES

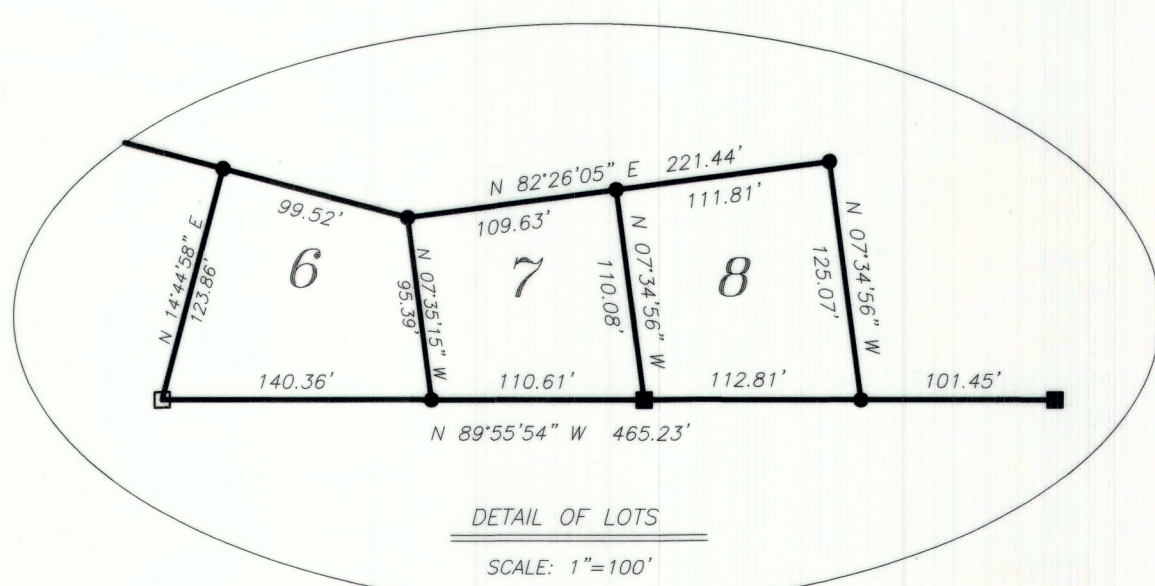

MONUMENTS FOUND AND TIED IN

PT#	DESCRIPTION
1	REBAR WITH WOODEN STAKE
2	WOODEN HUB
3	1/2" POST
4	1/2" REBAR WITH LATH
5	CLINT PEATROSS REBAR
6	IRON PIPE IN CONCRETE CYLINDER
7	ANGLE IRON PEG WITH WOODEN HUB
8	ANGLE IRON PEG
9	RODNEY ROWLEY REBAR
10	RODNEY ROWLEY REBAR
11	FENCE CORNER POST
12	5/8" REBAR
13	5/8" REBAR
14	5/8" REBAR
15	5/8" REBAR
16	5/8" REBAR
17	5/8" REBAR
18	5/8" REBAR
19	WOODEN HUB
20	5/8" REBAR
21	5/8" REBAR
22	5/8" REBAR
23	5/8" REBAR
24	5/8" REBAR
25	5/8" REBAR
26	5/8" REBAR
27	IRON ROD
28	5/8" REBAR AT FENCE CORNER
29	5/8" REBAR AT FENCE CORNER
30	5/8" REBAR
31	5/8" REBAR AT FENCE CORNER
32	5/8" REBAR AT FENCE CORNER
33	1/2" REBAR
34	5/8" REBAR
35	5/8" REBAR
36	5/8" REBAR
37	FENCE CORNER POST
38	1/2" POST
39	5/8" REBAR
40	5/8" REBAR
41	5/8" REBAR

NARRATIVE


This survey was performed at the request of Elliot Evans for the purpose of marking on the ground the corners of his lots as shown on this plat. MT. TABBY SPRINGS SUBDIVISION, in all of its phases, was surveyed and staked in the 1960's. In searching for original lots corners as part of this survey, as well as previous surveys done in this area, many different kinds of monuments were found and tied in. These monuments are listed in the MONUMENTS FOUND AND TIED IN table. The accuracy of the placement of the lot corners on the original survey was very poor. The best equipment available for use at the time was a transit or theodolite, and a steel tape. Given the steep and irregular terrain and the thick vegetation cover we felt fortunate to find the monuments shown. The data on the subdivision plats was plotted and it was found that the ties to the General Land Office monuments shown on the plats differed from each other and none of which fit the found monuments as part of this survey. A reasonably close fit for distance, as calculated from the data derived from the plats (2528.39 feet), and the distance measured on the ground by this survey (2529.91 feet), was found between the monuments found at numbers 1 and 23. The plotted configuration of the lots, from the plats, was rotated to fit this calibration line. The difference between these two values is 1.52 feet (a precision of 1/1664). Using this rotation the location of the remaining corners for Mr. Evans' lots were calculated from the data shown on the subdivision plat and rebar set as noted.

PROPERTY SURVEY FOR ELLIOT EVANS

LOTS 6, 7, AND 8, BLOCK 4, PLAT "1", MOUNT TABBY SPRINGS SUBDIVISION.
SECTION 36, TOWNSHIP 1 SOUTH, RANGE 8 WEST
UINTAH SPECIAL BASE AND MERIDIAN

SURVEYOR'S CERTIFICATE

I, Jerry D. Allred, do hereby certify that I am a Professional Land Surveyor, and that I hold certificate no. 148951 as prescribed by the laws of the State of Utah. I further certify that this plat and its computations were prepared from the field notes and electronic data collector files of an actual survey made by me, or under my personal supervision, of the parcels of land shown hereon, and that the monuments indicated were found or set during said survey, and that this plat accurately represents said survey to the best of my knowledge.

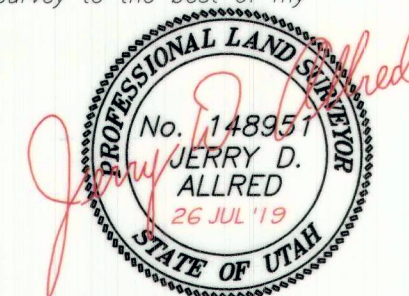

Jerry D. Allred, Professional Land Surveyor,
Certificate 148951 (Utah)

COUNTY SURVEYOR'S FILE NO. 4221

JERRY D. ALLRED & ASSOCIATES, INC.
SURVEYING CONSULTANTS
1235 NORTH 700 EAST--P.O. BOX 975
Duchesne, Utah 84021
(435) 738-5352

26 JUL 2019 19-100-044